


**GKH167-187**  
安装结构尺寸

**GKH167-187**  
Mounting Dimensional Description

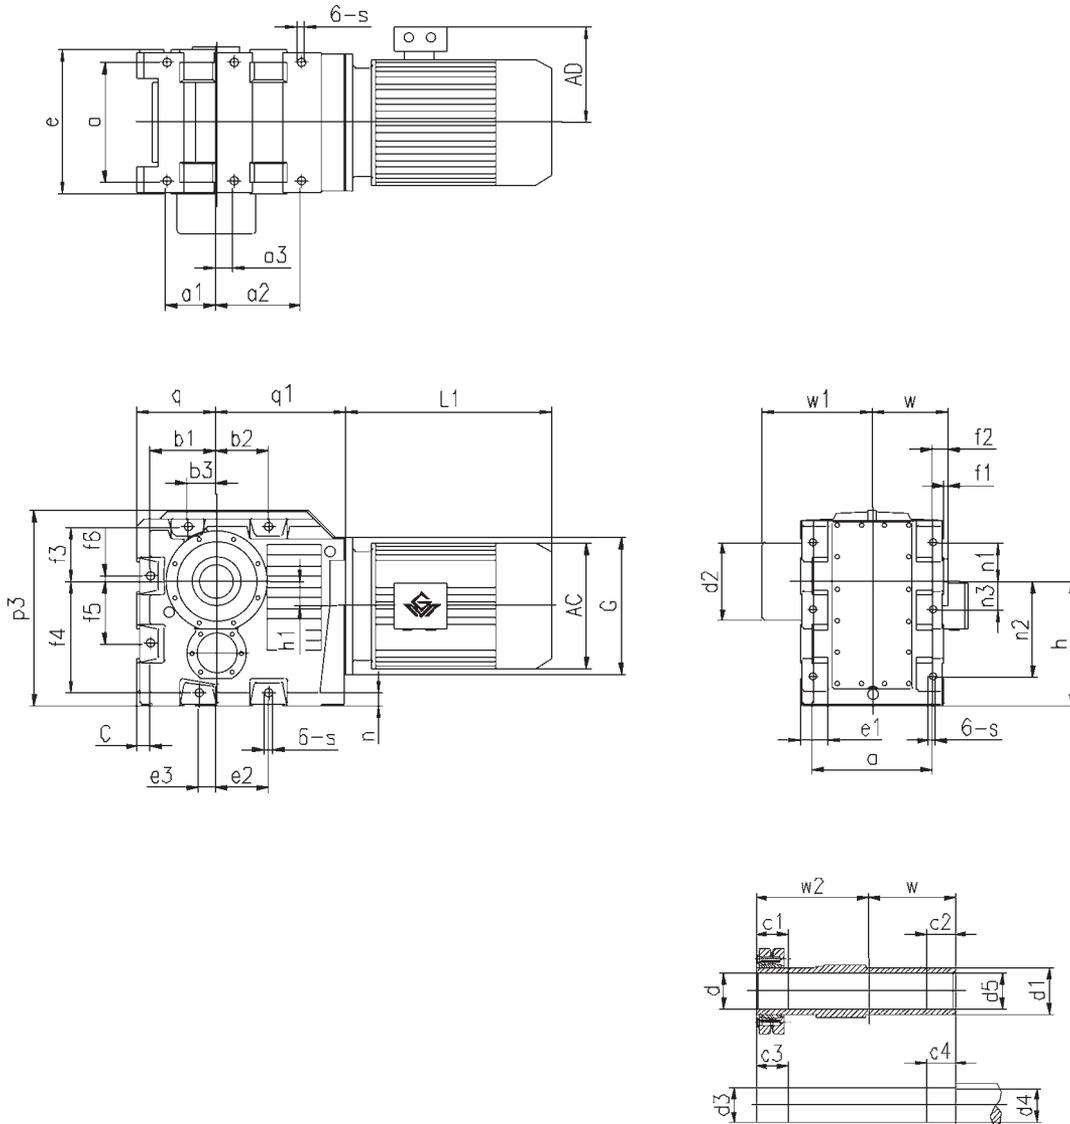

规格 Specification	$a_1$	$p_3$	$b_1$	$f_3$	$f_6$	$e_2$	$a$	$h$	$n_3$	$c_1$	$c_4$	$w_2$	$d$	$d_4$	电机尺寸 Motor Size		
	$a_2$ $a_3$	$q$ $q_1$	$b_2$ $b_3$	$f_4$ $f_5$	$h_1$ $n$	$e_3$ $c$	$f_2$ $f_1$	$n_1$ $n_2$	$e$ $e_1$	$c_2$ $c_3$	$w$ $w_1$	$s$ $d_2$	$d_5$ $d_3$	$d_1$ $G$	AC	AD	L1
GKH167	200	786	265	220	22	210	480	500 <sub>-1</sub>	115	122	100	423	Φ 135H7	Φ 140h6	见附录 A-2 Please see appendix A-2		
	340	315 <sub>-1</sub>	210	450	97	70	65	155	580	90	305	Φ 33	Φ 140H7	Φ 190			
	70	522	115	250	50	50	9	385	104	130	442	Φ 315	Φ 135h6	Φ 550			
GKH187	215	942	305	250	5	250	540	600 <sub>-1</sub>	150	117	105	455	Φ 155H7	Φ 160h6	见附录 A-2 Please see appendix A-2		
	405	355 <sub>-1</sub>	250	550	112	60	67	160	640	95	337	Φ 39	Φ 160H7	Φ 200			
	95	582	135	305	50	50	10.5	460	110	130	474	Φ 373	Φ 155h6	Φ 550			

注:电机需方配或配特殊电机时需加联接法兰(见附录 D)

Note: When equipping the user's motor or the special one, the flange is required to connected.(Please see appendix D)